

Home Inspection Report

12345 Main Street Sample Report



Inspection Information

CLIENT & SITE INFORMATION:

DATE: October 11, 2009.

CLIENT: Sample Report.

CLIENT PHONE: 555-555.

CLIENT EMAIL: sample.com.

INSPECTION SITE: 12345 Main Street.
INSPECTOR: William Rourke.

WEATHER CONDITIONS:

CURRENT WEATHER: Clear, Temperature in degrees Fahrenheit: 60-70.

PRIOR DAY WEATHER: Clear. SOIL CONDITIONS: Wet.

TIGER AGREEMENT AND STATEMENT-

Our Agreement and Statement paperwork as well a copy of the CT Standards of Practice for Home Inspection were provided to you. For your convenience in understanding the report the rating system is defined again below. During your contractual inspection period, you should carefully evaluate any property component or system that did not receive a "Functioning as Intended" rating in the report, any suggestions or comments made in the report, and any items or areas that are not included in the report.

Functioning As Intended - Component is functioning as originally intended, with normal wear and tear.

Maintenance/Upgrade - Work required to maintain component, or upgrade to current construction standards.

Not Functioning Properly - Component is in need of repairs or replacement.

Further Evaluation - Further evaluation by a specialist is suggested to determine the need for or extent of repairs/replacement and associated costs.

Not Inspected/Not Accessible - Component is not accessible. Please contact Tiger Group for a return inspection.

Page 3

Exterior

ROOF	SYSTEM:						
	Structure Type:	Slop	ed.				
	Surface Type:					n shinq 30 yea	gles. Expected roof life can be affected by many variables, irs.
	How inspected:	Fron	n a la	dder	at th	ne edge	e of the roof and binoculars from ground level.
	Number of Layers:	App	ears	to be	one	layer a	at accessible areas.
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Roof Assembly:	X					Underlayment- noted under the roofing material at an accessible edge. Drip Edge- metal drip edge noted.
	Overall Condition of Roof Surface:		X				Overall Condition: Roof covering appears to be at about 2/3 through its useful life, assuming proper maintenance and normal wear. Multiple nail pops noted at all slopes, vegetation and chalking stains noted on surface, caulk seal a flashing, rear vent stack rubber boot is splitting. Maintain the surface by cleaning and repairing areas as needed in order to extend the useful life of the roof.
EXTER	RIOR CHIMNEY:						
	Type and Components:	Mas	onry.	Flu	e cap	ce, blocking access to flue.	
	Condition of Masonry Chimney:	X					
	Condition of Flashing:		X		X		Flashing sealer noted, indicating prior repairs or preventative maintenance- monitor condition and maintain flashing performance to prevent water entry. Reset/repair loose flashing to prevent water entry. See related attic note.
	Accessible areas of flue/liner:						The interior of chimneys or liner condition is limited to visible inspection from readily accessible areas. Inspection is furthe limited by soot/creosote accumulation or design. Full inspection requires specialized equipment and in some cases, cleaning. Requirements for flue liners and flue sizing is beyond the scope of a home inspection. Consult with a chimney sweep for a full inspection.
SIDING	G :						
	Type of Construction:	Woo	d fra	me.			
	Vinyl or Aluminum Siding Description:		X				Vinyl siding- Clean mildew growth/staining or other staining to maintain. Minor damage or denting noted, repair as needed.
TRIM:							
	General Trim - Type and Condition:		X				Vinyl, Metal wrapped surfaces, condition of the materials below is not accessible. Reset displaced soffit vent material at front and rear. Maintair caulk sealed areas.
	Window/Door Trim -Type and Conditions:		X				Vinyl, Metal wrapped surfaces, condition of the materials below is not accessible. Conditions are similar to General Trim.
WINDO	OWS AND DOORS: Exterior Entry Doors:	X					
	Exterior of Windows:	X					
	Flashing - Windows & Doors:					X	The window and door flashing is not accessible, its application and performance cannot be determined through visual inspection.

EXPOSED GUTTER AND DOWNS	POL	JTS:				
	Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
TYPE AND CONDITION:					<u>'</u> '	Metal. Maintenance repairs suggested: debris in gutter, cleaning/repair/adjustment needed. Subsurface drains noted, they are beyond the scope of visual inspection, suggest confirmation of system termination and performance with owner. Repair connector at rear, determine discharge of seasonal room gutters.
YARD DRAINAGE, GRADING, LAN	IDSC	CAP	E:			
Grading and Drainage:		X				Improve all grading to allow minimum slope of 6 inches within 10 feet of building. Refer to the TIGER Wood Boring Insect diagram. Yard drains noted, identify termination and monitor performance during rains - Consult owner as needed.
Landscape:		X				Vegetation is contacting or near the building - suggest trimming or removal to prevent negative effects. Refer to the TIGER Wood Boring Insect diagram.
BASEMENT ENTRY: Type and Condition:	X					
BASEMENT WINDOWS/VENTS: Conditions:		X				
EXTERIOR FAUCET: Condition:	X					
ELECTRIC SERVICE ENTRY: Type and Condition:	X					Underground, meter, Service Size - appears to be 200 amp service based on exterior breaker or wire size.
LIGHTING AND OUTLETS: Electric Outlets:	X					GFCI protected.
Lighting (on building):	X					
WALKWAYS AND DRIVEWAYS Walkways Type and Condition:	П	X	П	П	П	Pavers. Reset uneven areas.
Driveway Type and Condition:		X				Asphalt. Fill cracks and seal surface to maintain asphalt driveway.
DECK/ ENTRY/ PORCH:						
Location and Type:	Fron	nt, Ma	asonr	y.		
Overall Condition:	X					Accessible areas are functioning as intended.
Flashing:		X				Prior seal noted at joint to house indicates repair or preventative seal, consult owner for historical perspective and monitor conditions for repair.
DECK/ ENTRY/ PORCH:						
Location and Type:		r, Wo	od fi	ame	d deck	with seasonal use room.
Overall Condition:	X					Accessible areas are functioning as intended.
Flashing:		X				Prior seal noted at joint to house indicates repair or preventative seal, consult owner for historical perspective and monitor conditions for repair.
Decking/Surface:		X				The decking materials need some maintenance/repair - clean and treat surface.
Porch Conditions:						related notes at exterior section for roofing, siding, trim, gutter at skylight and roof panels - no leak stains present at exterior.

Garage

INTER	IOR/STRUCTURE:						
	Type:	Und	er livi	ing s	pace.		
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Overall condition:	X					
	Foundation:	X					Concrete.
	Floor:	X					Concrete.
	Wall Structure:	X					Wood frame.
	Fire Separation:	X					
	Finished Ceiling/Walls:	X					
	Columns:	X					
	Evidence of Water Entry:					X	No visible or accessible evidence at the time of inspection. The evidence, source or amount of water penetration may not always be observable at the time of this inspection, therefore we suggest you consult with the owner for a history of water entry.
	Windows:	X					·
DOOR	S:						
	Overhead Door:	X					
	Overhead Door Opener:	X					
	Fire Door:	X					
ELEC	FRICAL and MECHANICAL: Switches and Lights:	X					
	Interior Outlets:	X					Ground fault protected - provide dedicated circuit for refrigerator/freezer as needed.

Basement

4	CC	ES	SIBI	_E /	٩R	EA	S:
---	----	----	------	------	----	----	----

Access:

Comments relate to accessible areas only, conditions exist that limit access- insulation, mechanical equipment or ductwork, storage items (suggest review the final walk-through or after the home is vacated)

		or ai	ter tr	ie no	ime i	s vacat	ea)
FOUN	IDATION AND FLOOR:		_				
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Foundation:	X					Concrete. Surface finish applied to interior foundation and wall sections.
	Floor:	X					Concrete.
BASE	MENT COMPONENTS: Windows:	X					
	Staircase:	X					
	Lighting:	X					
	Electric Outlets:	X					
EXPO	SED FRAMING: Overall Condition:	X					
	Girder(s):	X					Type: Wood-dimensional lumber built-up beam.
	Columns:	X					Type: Concrete filled, steel lally columns.
	Sill:	X					Wood.
	Subfloor:	X					Plywood.
	Floor Joists:		X				2x10 Spaced, 16" on center. Mildew/mold on some framing members, remediate as needed. Monitor notched framing above service panel.
INSUL	_ATION:						
	Conditions:	X					Fiberglass, Depth: 3-4". Damaged or missing insulation noted, suggest repairs or upgrade.
CHIMI	NEY BASE: Condition:	П	X	П	П		Wood hearth forms in place, suggest removal for proper fire
		_		_	_	_	safety. Maintenance repairs or upgrades to current standard are suggested. Evidence prior water entry noted, suggest identification of source and repair as needed.
	Cleanout Access:		X				Suggest removal of buildup.
EXTE	RIOR ACCESS: Type and Condition:		X				Bulkhead access doors. There is evidence of water entry at
							the doorway into the drain system, monitor.
WATE	ER PENETRATION AND DAMI Conditions:	PNE	SS:				The evidence, source, amount, or frequency of water penetration may not always be observable or evident at the time of this inspection. We suggest you consult the owner for a historical perspective of water penetration. If we indicate signs of water penetration you should anticipate the possibility of ongoing water entry and the need for controls unless a warranted system has been installed.
							Evidence of prior water penetration, suggest consulting with the owner for history and with a contractor for analysis and

Page 7

Report: 12345 Main Street

estimates to prevent entry. Evidence noted- moisture stains.

Eurctioning as Intended as Intended / Upgrade / Upgrade Property Further Evaluation Not Inspected Inspected

Sump Pump:

There is a sump pump installed, the pump and drain lines should be checked periodically. If it is accessible we are limited to testing the operation by operating the float. This does not represent the performance of the pump, drain or any sub slab drainage system. Consult with the owner for the history of basement water entry, if none available consider further analysis of the pump and or drain system by a specialist. Suggest adding a sealed cover to the sump basin. Pump drain- accessible areas appear functional, monitor performance periodically. Backup- no battery back-up installed, consider upgrade. Consult installation company regarding warranty or maintenance requirements. A dedicated single electrical outlet is ideal for sump pump application. GFCI outlets are prone to tripping, disconnecting power to pump.

Wood Boring Insects:

Wood Boring Insect:

A separate Wood Boring Insect report is provided with your inspection on site. Please review and follow through on directions as needed. Please contact our office if your financing requires additional paperwork.

Additional Comments:

Rodent or Animal activity:

The investigation for rodent, pest or animal evidence is beyond the scope of a home inspection. If evidence is noted, suggest further evaluation by a specialist to determine need for and method of extermination. Rodent nesting or droppings noted, suggest further evaluation to determine extent and options to control. Evidence of extermination, consult owner for history and as needed service company to determine extent and options to control.

Heating, Cooling, Ventilation

FUEL	. SUPPLY:						
	Fuel Source:	Oil F	ired.				
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Oil Tank:	 	<u>'</u> П				An ultrasonic test for your aboveground oil tank has been provided through the Tanksure program. We will submit the information to Tanksure and a certificate will follow by mail to report conditions. You must execute the certificate through a member oil company in order to obtain the warranty. You may be contacted by Tanksure member Oil and Homeowner insurance providers.
	Fuel Shutoff Location:	At U	nit.				
SYST	EM COMPONENTS:						
	Thermostat Condition:	X					Location: First Floor, Second floor.
	Emergency Shutoff Location:	Stail	rs.				
	Exposed Flue/Damper:	X					Conditions of the interior of the flue are not accessible and are beyond the scope of inspection. In enclosed utility areas, it is recommended that adequate combustion/ventilation air be maintained, avoid storing flammable or other material in this area. Metal.
	Safety Components:	Reli	ef va	lves,	valve	es, gau	uges, switches, and other safety devices cannot be tested.
	Records Available:	X					Contact the current service provider to obtain information on the history of the unit and any inaccessible components. This report indicates the condition of the systems on the day of the inspection without regard to life expectancy; therefore, we suggest that you obtain a major service policy from a service company that should include annual servicing/safety check, efficiency testing, warranty and emergency service. Date of last recorded service: Scasco 9/25/09.
FUKN	IACE/AIR HANDLER: Type and Condition:	X	П	П	П		Thermopride Forced Air Furnace operated normally.
	Heat Exchanger:	In o	ting t	echn	ician	e a hea is requ	at exchanger disassembly or technically exhaustive testing by a uired. This report does not represent the condition of the Heat and that you have this evaluated by a service company.
	Burner(s):	X					
	Fire Chamber:					X	Evaluate when cleaning.
	Circulator Fan:	X					
	Filter Condition:		X				Type: Reusable - Wash and reuse.
	Accessible Ductwork:		X				Type: Fiberglass board. Consider further investigation or research regarding potential concerns with fiberglass duct interior buildup and cleaning related to indoor air quality.
	Humidifier:					X	Yes, there is a humidifier installed. The scope of this inspection does not include determining if the unit is operational. Not functional, upgrade as needed.
COO	LING SYSTEM or HEAT PUM	P:					
	Type and Condition:		X		X		American Standard Split System, electric. System functioned as intended at the time of inspection. Obtain service records - none posted on unit, system should be serviced annually, if none available service before use. We recommend obtaining

						a service contract.
	Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
Service lines:	X					Visual conditions noted, inspection does not include technically exhaustive pressure/temperature testing.
Condenser Visual Conditions:	X					Estimated Age: 4/2000. Clean when servicing.
Electric Disconnect:	X					
Condensate Drain:	X					
Temperature Differential:	X					The desired temperature differential is 15 - 22 degrees F.

Page 10

Electric Systems

ACCESSIBLE WIRING

	Type and Conditions:	Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not	Type: Romex type, plastic insulated copper.						
MAIN	SERVICE PANEL												
	Disconnect Location:	At M	lain F	Panel									
	Panel Size and Location:	Basement. Size: 200 Amp.											
	Service Cable Type:	Alun	ninur	n.									
	Panel Condition:	X					The accessible components of the panel, are functioning as intended.						
	Breakers or Fuse Condition:		X		X		Breaker(s) have more than one wire/circuit installed in the terminal, this can cause loose wires or overload of breakers Repair needed at top left double tap, breaker is intended to serve one wire/circuit.						
	Service Ground:	X											
SUBP	ANEL(S)												
	Location:	Base	emer	nt.									
	Panel Condition:	X											
OTHE	R COMPONENTS:												
	Smoke Detectors:	X				X	Part of alarm system, unable to test. Consult installer or maintenance company for information.						

Plumbing System peration of main valves, individual fixture to the properties.

GENE	RAL COMMENT:											
	Comment:	Operation of main valves, individual fixture shutoffs and other valves is beyond the scope of inspection.										
SUPP	LY PLUMBING:											
	Water Service:		ectio				place. Determination of water quality is beyond the scope of ger Statement document to determine applicable optional water					
		sepa		from			wn as Optional tests, see Tiger Statement and results to follow ection report. Service pipe type- Plastic. Main Valve location-					
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected						
	Interior Piping:	X					Copper.					
	Interior Water Flow:	X					Interior water flow is tested by monitoring visual effects of operating multiple fixtures simultaneously.					
ACCE	SSIBLE WELL EQUIPMENT:											
	Operation/Condition:	X					Refer to Tiger Functional Flow test results. Well System Pressure Tank, Bladder Tank, Suggest consulting owner or prior service company regarding history of pump repairs and its age. Pump Type: Submersible pump, not accessible due to location in well.					
DRAIN	WASTE/VENT PLUMBING:											
DIVAII	Sewage Disposal:	Verification of type of system is beyond the scope of inspection. Suggest verification of conditions beyond the house with the owner or through testing. Public Sewer Systemmain waste pipe from the house to sewer system is beyond the scope of a home inspection.										
	Materials and Condition:	X					Materials: Plastic. Leak stains noted at front foundation where piping terminates - see exterior notes.					
	Accessible Venting:	X										
	Functional Drainage:	X										
	Waste Line Cleanout:	X					Located, in the basement.					
LALINI	DRY CONNECTIONS:											
LAUN	Location:	Kitch	nen a	irea.								
	Washer Connection:		X				No spill pan installed under the washing machine, consider adding to prevent damage in the event of leaking.					
	Dryer Connection:	X										
WATE	R HEATER:											
	Description:					ype: In .ge:199	dividual tank water heater. Tank Size: Approximately 70-80 93.					
	Overall Condition:		X				Aged tank, appears to be functioning however you should budget for replacement. Our standard test for the hot water system is to fill a tub at a usable temperature for bathing. Tub was successfully filled.					

Kitchen

(ITC	CHEN:		
	Location:	Main Level.	
		Functioning as intended Maintenance /Upgrade Properly Properly Not Eurther Evaluation Not Inspected Inspected	
	Sink:	☐ 🛛 ☐ ☐ Maintenance repairs needed at sink. There is evidence of leak at the faucet.	of a
	Countertops:		
	Cabinets:		
	Walls/Ceiling:		
	Windows:		
	Floor:		the
	Electrical Outlets:		
	Lighting:		
	Heat Source:		
٩PP	LIANCES:		
	Stove Top:		
	Oven:		
	Ventilation:		
	Dishwasher:		
	Food Waste Disposal:	Monitor and minimize disposal use with a septic system, inform septic service company for proper maintenance a suggestions.	nd
	Comments:	Unless otherwise noted, all appliances listed are working on the day of the inspectic We do not represent a guarantee or warranty of the continuous operation of the appliances. Self-cleaning mechanism, timers, clocks, thermostats, gasket or seal performance and cosmetic blemishes are not part of this inspection report. Microwa	

Bathrooms

OVERALL BATHROOM COMMENTS:

	General Comment:						
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Tub/Shower Walls:						Inspection is limited to visual conditions at tub/shower wall, conditions behind finished surfaces are not accessible. Maintain all caulk and grout seals to prevent negative effects of moisture.
	Heat Source:						
BATH	HROOM:						
	Location/Label:		bath				
	Sink:	X					
	Cabinet(s)	X					
	Toilet:	X					
	Electrical Outlets:	X					GFCI in place.
	Lighting:	X					
	Floor:	X					
	Window(s):	X					
	Walls/Ceiling:	X					
	Door(s):	X					
	Heat Source:	X					Diffuser.
BATH	HROOM:						
	Location/Label:		ond I	Floor	_	_	
	Sink:	X	Ц		Ц		
	Cabinet(s)	X	Ц	Ш	Ц		
	Tub/Shower:	X	Ш		Ш	Ш	Type: Tub/shower combination.
	Tub/Shower Walls:	X					Type: Fiberglass.
	Toilet:	X				Ш	
	Electrical Outlets:	X					
	Lighting:	X					
	Floor:	X					
	Window(s):	X					
	Walls/Ceiling:	X					
	Door(s):	X					
	Heat Source:	X					
	Ventilation Fans:	X					
BATH	HROOM:						
	Location/Label:		ter B		_		
	Sink:	X					
	Cabinet(s)	X					
	Tub/Shower:	X					Type: Shower and Tub.

	Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
Tub/Shower Walls:	X					
Toilet:	X					
Electrical Outlets:	X					
Lighting:	X					
Floor:	X					
Window(s):	X					
Walls/Ceiling:	X					
Door(s):	X					
Heat Source:	X					Diffuser.
Ventilation Fans:	X					

Interior Rooms

INTERIOR COMPONENTS:							
		Functioning as Intended	Maintenance /Upgrade	Not Functioning Properly	Further Evaluation	Not Inspected	
	Front Entry Door:	X				''	
	Rear Entry Door:	X					
	Main Stairway:	X					
	Hallway:	X					
FIREP	LACE(S) AND STOVES: Wood Fireplace(s):		X		X		Living Room, Inspection is limited to visible areas of the fireplace, test fires are not started, analysis of draft is beyond the scope of a home inspection. Masonry fireplace in place. The fireplace flue is in need of cleaning, this also normally includes inspection. Typical buildup from use noted. Debris
OVER	ALL INTERIOR COMMENTS: Comment:	Insp treat were antic Cos cond	tmen e insp cipate metic dition	ts or pecte ed. defe , fadi	store d. O ects a	ed item: Ingoing are bey	noted at damper; reset, clean or repair as needed before use. sible area that are not blocked by furniture, finishes, window s. At a minimum a representative number of like components adjustment or repairs of doors and windows should be cond the scope of a home inspection. Items such as flooring ag paint, holes in walls, doors, ceiling and trim are not reported
ROOM	ıs·						
NOO!!	Label/Location:	First	t Floc	or.			
	Ceiling/Walls:	X					
	Windows:	X					
	Floor:	X					
	Door(s):	X					
	Electric Outlets:	X					
	Light/Switch:	X					
	Heat Source:	X	Ш	Ш	Ш	Ш	
ROOM	Label/Location: Ceiling/Walls: Windows: Floor: Door(s): Electric Outlets: Light/Switch: Heat Source:	Secondary Second	ond F	Floor.			

Page 16

Attic ATTIC ACCESS: Pull Down. Consider adding insulation for improved energy Attic Access: efficiency. **ACCESSIBLE STRUCTURE:** Roof Framing: X \mathbf{X} Rafters- 2x10, spaced- 16" on center. Some collar ties present, add secondary framing at separated rafters along ridge for additional support. Roof Backing: X П П Plywood. Ceiling Joists: X No Access due to insulation or flooring materials in place. Visible Flashing Condition: X X There is evidence of a active leak noted at the chimney П flashing- repair as needed. **INSULATION:** Type and Conditions: Loose Fiberglass: Depth: 10" plus. Insulation has been X disturbed, redistribute/reset as needed for consistent coverage. **VENTILATION:** Type and Conditions: Type: Soffit vents, Ridge vents, Gable end vents. **DUCTWORK:** Type and Condition: **WATER PENETRATION:** The evidence, source or amount of water penetration may not always be observable at Evidence of Leaks: the time of inspection. We suggest you consult the owner for a historical perspective of

ANIMAL/BIRD ACTIVTY:

Evidence noted: The inspection for and identification of animal or bird evidence is beyond the scope of a

whether evidence of water penetration has been noted or not.

home inspection. Reference to any evidence should be followed by analysis by a

specialist or control/cleanup as needed.

Photos

Representative photos are provided for your convenience, they do not indicate summary items or level of concern. Please refer to the report details.

Photo Log:

Photo #1: Roofing conditions, including lifting shingles.



Photo #2: Example of exterior maintenance needed.



Photo #3: Chimney flashing conditions at exterior.



Photo #4: Leak stain at rear basement foundation.



Photo #5: Attic framing separation at ridge board.







Local Inspectors Available:

Cheshire...203-272-3635 Danbury...203-778-0095 Glastonbury...860-633-8928 Hartford...860-278-1224 Madison...203-245-3020 New London...860-444-1616 Stamford...203-316-9206 Trumbull...203-452-7274 Westport...203-221-1163

REPORT SUMMARY

12345 Main Street, Sample Report

The following notes are excerpts from the report indicating components that are not *Functioning as*Intended. They are rated *Not Functioning Properly - component is in need of repairs or replacement* or *Further Evaluation by a specialist is suggested to determine the need for or extent of repairs/replacement and associated costs* on our rating system(See Agreement).

Exterior

EXTERIOR CHIMNEY:

Condition of Flashing: Reset/repair loose flashing to prevent water entry.

Heating, Cooling, Ventilation

COOLING SYSTEM or HEAT PUMP:

Type and Condition: Obtain service records - none posted on unit, system should be serviced annually, if none available service before use. We recommend obtaining a service contract.

Electric Systems

MAIN SERVICE PANEL

Breakers or Fuse Condition: Repair needed at top left double tap, breaker is intended to serve one wire/circuit.

Interior Rooms

FIREPLACE(S) AND STOVES:

Wood Fireplace(s): Living Room, Masonry fireplace in place. The fireplace flue is in need of cleaning, this also normally includes an inspection. Typical buildup from use noted. Debris noted at damper; reset, clean or repair as needed before use.

Attic

ACCESSIBLE STRUCTURE:

Roof Framing: Rafters- 2x10, spaced- 16" on center. Some collar ties present, add secondary framing at separated rafters along ridge for additional support.

Visible Flashing Condition: There is evidence of a active leak noted at the chimney flashing-repair as needed.